## Product sheet Miniature connector

4




Product


Pole

Contacts: 4, cable plug connector with cable clamp, screw terminal connection, shieldable, cable outlet 6 - 8 mm

Area Article number M16 IP67 Series 423 99 5609 210 04

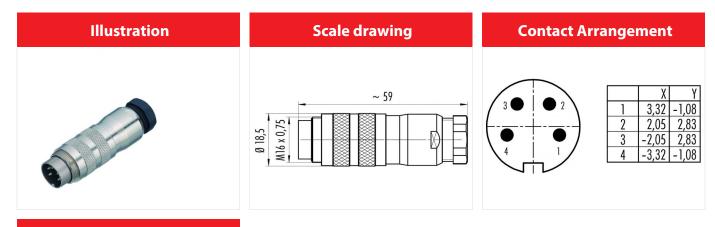

Attenuation characteristic

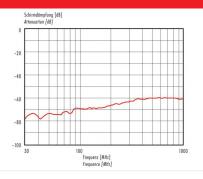

You can find the item description and assembly instruction on the next page.

# **Technical data**

## **Common values**

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature

#### Cable plug connector screw Screwing $0.25 - 1.5 \text{ mm}^2$ 24 - 166 - 7.8 mm95 °C-40 °C

## **Electrical values**

Rated voltage Rated impulse voltage Pollution degree Overvoltage category Material group Rated current (40°C) Volume resistivity EMV compliance Degree of protection Mechanical operation

## Material

Material of contact Contact plating Material of contact body Material of housing 250 V 1500 V 1 I II 6 A  $\leq 5 m\Omega$ shielded IP67 > 500 mating cycles

CuZn (Brass) Ag (Silver) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 4, Cable plug connector with cable clamp, screw terminal connection, shieldable, cable outlet 6 - 8 mm, silver plated contacts



# **Product sheet** Miniature connector

4




Product

Contacts: 4, cable plug connector with cable clamp, screw terminal connection,

Area Article number M16 IP67 Series 423 99 5609 210 04

Pole

shieldable, cable outlet 6 - 8 mm

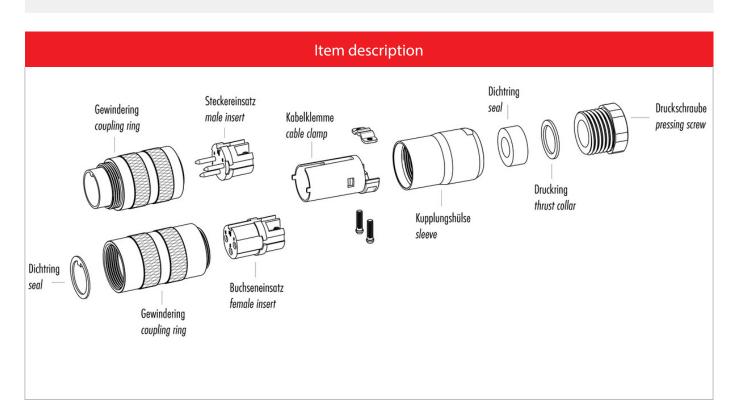

## Installation instructions / Mounting cutout

### **Gerade Version**

#### (Ausführung mit Schirmklemmring)

- 1. Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- 3. Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

### Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- 3. Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

