#### **Product sheet**

Pole

# Miniature connector



Contacts: 6 DIN, Female cable connector Product with shielding ring, shieldable, cable


outlet 6 - 8 mm, with UL approval

Area Article number M16 IP67 Series 423 99 5622 15 06


#### Illustration



# **Scale drawing**

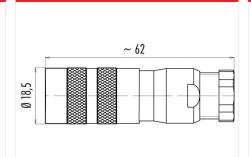

## **Contact Arrangement**




weiß/white

braun/brown blau/blue schwarz/black

grau/grey grün/green

#### **Attenuation characteristic**

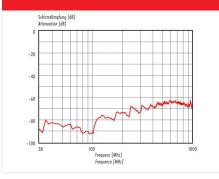

You can find the item description and assembly instruction on the next page.

# **Technical data**

## **Common values**

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature

Female cable connector screw Solder 0.75 mm<sup>2</sup> 20 6 - 7.8 mm 95 °C -40 °C

#### **Electrical values**

Rated voltage 250 V Rated impulse voltage 1500 V Pollution degree Overvoltage category Material group Ш Rated current (40°C) 5 A Volume resistivity  $\leq 5~m\Omega$ EMV compliance shielded Degree of protection Mechanical operation > 500 mating cycles

#### **Material**

Material of contact Contact plating Material of contact body Material of housing

CuSn (Bronze) Ag (Silver) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 6 DIN, Female cable connector with shielding ring, shieldable, cable outlet 6-8 mm, silver plated contacts, with UL approval

#### **Product sheet**

# Miniature connector




Product Contacts: 6 DIN, Female cable connector with shielding ring, shieldable, cable

outlet 6 - 8 mm, with UL approval

Pole 6 DI

Area Article number M16 IP67 Series 423 99 5622 15 06

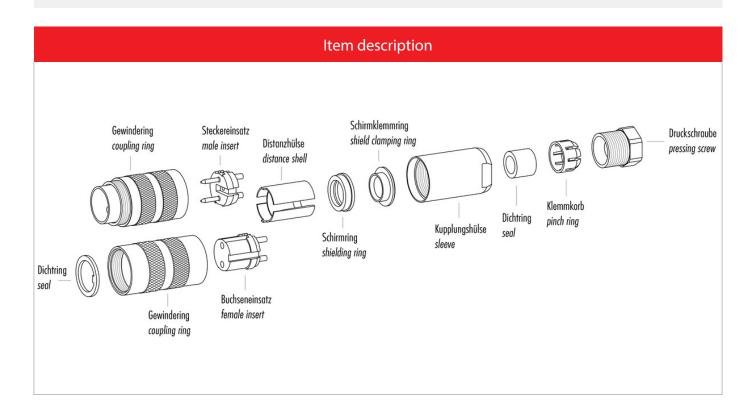

# Installation instructions / Mounting cutout

#### **Gerade Version**

(Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

## Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

