Product sheet


Subminiature connector




Product Contacts: 3, Cable plug connector
Pole 3

Cable plug connector Area Article number Micro Push-Pull IP67 Series 420 99 4705 00 03

Illustration

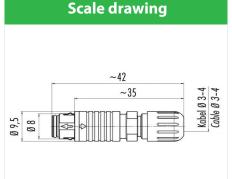

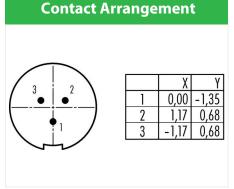

You can find the item description and assembly instruction on the next page.

Technical data

Common values

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature Cable plug connector Micro Push-Pull Solder 0.14 mm² 26 3 - 4 mm 80 °C -40 °C

Cable data

material housing Insulation single lead Single lead structure Conductor resistance -

Electrical values

Rated voltage 125 V Rated impulse voltage 1500 V Pollution degree 2 Overvoltage category Ш Material group Ш Rated current (40°C) 1 A Volume resistivity $\leq 8 \, m\Omega$ EMV compliance not shieldable Degree of protection IP67 Mechanical operation > 1000 mating cycles

Material

Material of contactCuZn (Brass)Contact platingAu (Gold)Material of contact bodyPAMaterial of housingPA

Contacts: 3, Cable plug connector

Product sheet


Subminiature connector



Product Pole Contacts: 3, Cable plug connector

3

Area Article number Micro Push-Pull IP67 Series 420 99 4705 00 03

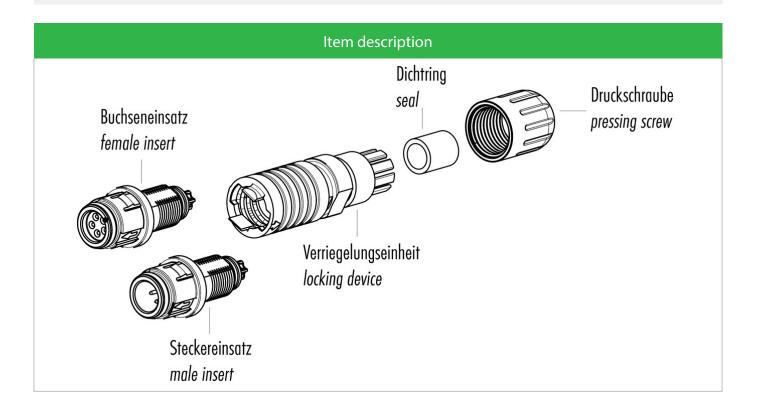

Installation instructions / Mounting cutout 1. Abmanteln auf L = 9mm. Ummantelung abstreifen. 2. Dichtring in Klemmvorrichtung montieren. Druckschraube und Verriegelungseinheit auf Kabel auffädeln. 3. Litzen abisolieren (I = 3mm) und verzinnen. 4. Einsätze anlöten. Verriegelungseinheit orientiert, Pfeilrichtung beachten, aufschieben und aufschrauben. 6. Druckschraube aufschieben und vor dem Festziehen an Schlüsselfläche kontern. (Bei Demontage zuerst Druckschraube öffnen) 1. Strip to 9mm length and remove cable jacket. Mount sealing ring to clamp device to cable Bead pressing screw and clamp device. Strip the insulation off the wires (I = 3mm) and tin them. Solder wires to solder cups. Align locking unit, bear in mind direction of arrow, push forward and screw tightly. 6. Push pressing screw forward and secure them at flats. (Before unmounting first open pressing screw.)