Product sheet

Miniature connector




Product

Contacts: 7, Cable plug connector, short version, cable outlet 4 - 8 mm, with UL approval

M16 IP67 Series 423 99 5125 40 07


Pole



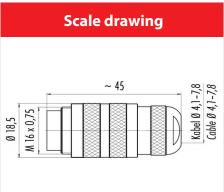

Area

Article number

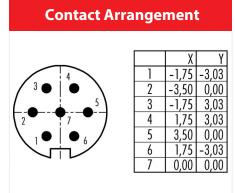

You can find the item description and assembly instruction on the next page.

Technical data

Common values

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature

Cable plug connector screw Solder 0.75 mm² 20 4 - 8 mm 95 °C -40 °C

Electrical values

Rated voltage 125 V Rated impulse voltage 800 V Pollution degree Overvoltage category Material group Ш Rated current (40°C) 5 A Volume resistivity \leq 3 m Ω EMV compliance not shielded Degree of protection IP67 Mechanical operation > 500 mating cycles

Material

Material of contact Contact plating Material of contact body Material of housing

CuZn (Brass) Au (Gold) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 7, Cable plug connector, short version, cable outlet 4 - 8 mm, gold plated contacts, with UL approval

Product sheet

Miniature connector




Product

Contacts: 7, Cable plug connector, short version, cable outlet 4 - 8 mm, with UL

approval

Pole

Area M16 IP67 Series 423 Article number 99 5125 40 07

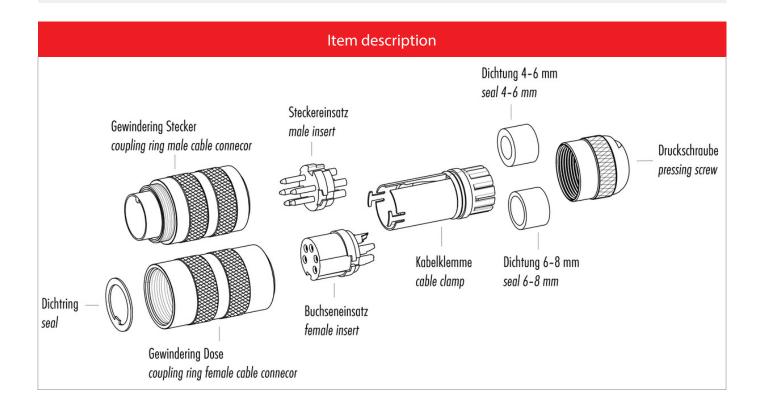

Installation instructions / Mounting cutout

Gerade Version

(Ausführung mit Schirmklemmring)

- 1. Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- 3. Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- 3. Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

