
# Product sheet Miniature connector



Product

Pole

Contacts: 4, Cable plug connector, short version, cable outlet 4 - 8 mm, with UL approval 4 Area Article number M16 IP67 Series 423 99 5109 40 04

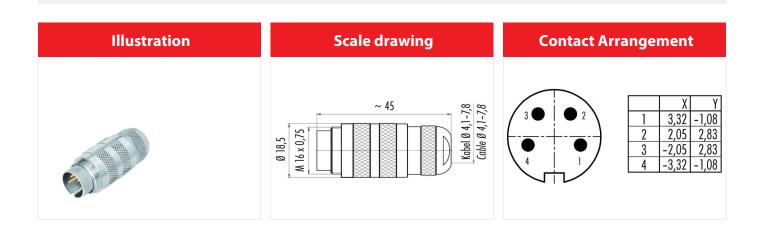

### You can find the item description and assembly instruction on the next page.

## **Technical data**

### **Common values**

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature Cable plug connector screw Solder 0.75 mm<sup>2</sup> 20 4 - 8 mm 95 °C -40 °C

## **Electrical values**

Rated voltage Rated impulse voltage Pollution degree Overvoltage category Material group Rated current (40°C) Volume resistivity EMV compliance Degree of protection Mechanical operation

### **Material**

Material of contact Contact plating Material of contact body Material of housing 250 V 1500 V 1 I II 6 A  $\leq 3 m\Omega$ not shielded IP67 > 500 mating cycles

CuZn (Brass) Au (Gold) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 4, Cable plug connector, short version, cable outlet 4 - 8 mm, gold plated contacts, with UL approval



# Product sheet Miniature connector




Product

Pole

Contacts: 4, Cable plug connector, short version, cable outlet 4 - 8 mm, with UL approval 4

Area Article number M16 IP67 Series 423 99 5109 40 04

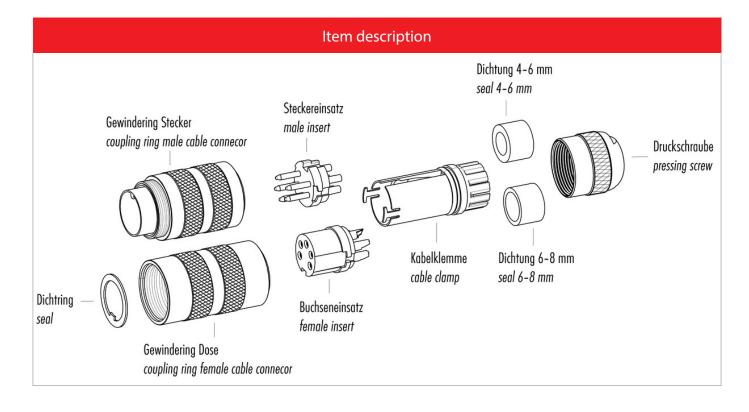

## Installation instructions / Mounting cutout

#### **Gerade Version**

#### (Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

#### Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

