Product sheet

Miniature connector



Product Contacts: 5, Female cable connector, short


version, cable outlet 4 - 8 mm, with UL


approval

Pole

Area **M16 IP67 Series 423** Article number **99 5114 40 05**



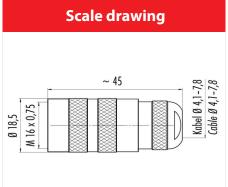

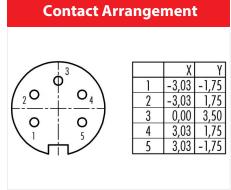

You can find the item description and assembly instruction on the next page.

Technical data

Common values

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature Female cable connector screw Solder 0.75 mm² 20 4 - 8 mm 95 °C -40 °C

Electrical values

Rated voltage 250 V Rated impulse voltage 1500 V Pollution degree Overvoltage category Material group Ш Rated current (40°C) 6 A Volume resistivity \leq 3 m Ω EMV compliance not shielded Degree of protection IP67 Mechanical operation > 500 mating cycles

Material

 Material of contact
 CuSn (Bronze)

 Contact plating
 Au (Gold)

 Material of contact body
 PBT (UL 94 V-0)

 Material of housing
 CuZn (Brass nickel-plated)

Contacts: 5, Female cable connector, short version, cable outlet 4 - 8 mm, gold plated contacts, with UL approval

Product sheet

Miniature connector




Product Contacts: 5, Female cable connector, short

version, cable outlet 4 - 8 mm, with UL

approval

Pole 5

Area Article number M16 IP67 Series 423 99 5114 40 05

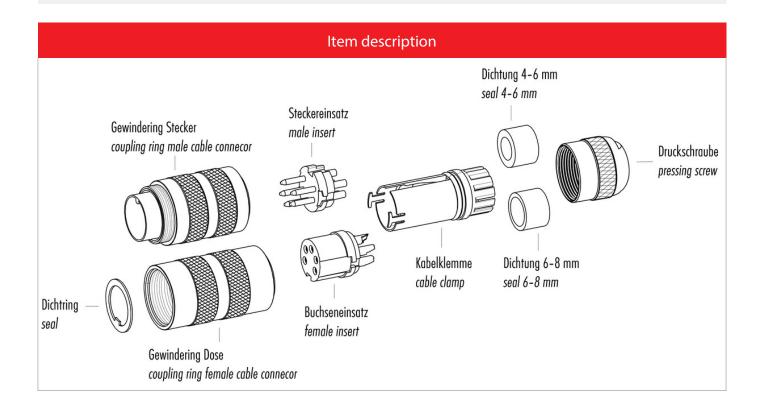

Installation instructions / Mounting cutout

Gerade Version

(Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

